# **SubArc Digital Series**

# **Submerged Arc** Welding Power Source



# Quick **Specs**

# **Heavy Industrial Applications**

Railcar Shipbuilding Heavy Fabrication Pipe Manufacturing Pressure Vessel

### **Processes**

Submerged Arc (SAW) Electroslag (ESW)

# **Input Power**

Requires 3-Phase Power

Rated Output DC 650/800: 650 A at 44 V, 100% Duty Cycle

**DC 1000/1250:** 1000 A at 44 V, 100% Duty Cycle AC/DC 1000/1250: 1000 A at 44 V, 100% Duty Cycle

Weight DC 650/800: 545 lb. (247 kg)

DC 1000/1250: 644 lb. (292 kg) AC/DC 1000/1250: 1225 lb. (540 kg)

# Miller SubArc Digital Series

- Choice of three power sources, two interface controls and a range of wire drive motors and accessories.
- Digital process control technology.
- Highly reliable thyristor power regulation.
- Newly designed digital control and communication electronics improve weld performance and simplify the integration of the equipment in more advanced applications.



SubArc DC 1000/1250 Digital

SubArc DC 650/800 Digital

Two DC power source models and one AC/DC power source model.

New!

Power sources have sufficient power capacity to cover applications from traditional DC single-arc to multi-wire tandem welding. In the case of Electroslag welding or other high-current demand, two or more power sources can easily be paralleled (both DC and AC/DC machines).

The SubArc Digital Series Interface controls recognize the power source and wire drive connected, and automatically configure the system for proper operation. The easy-tounderstand interface provides the operator with the necessary controls to set process parameters and control output. The power sources feature simplified parallel and tandem setups — just plug the cable into the appropriate connectors.

Easier setup and operation.

### Improved flux delivery system.

Our new SubArc Flux Hopper utilizes a flux valve mechanism that assures continuous delivery of flux to the arc. The unique valve design provides a barrier between the flux and actuation device to help prevent jamming of the solenoid actuator due to dust and debris. A sight glass is provided on the front of the flux hopper allowing the weld operator to visually monitor the remaining flux in the hopper.

Low-voltage accessory operation and improved environmental protection. The new Digital Series accessories are powered with 24 VAC control voltage from the power source. All power sources, interface controls and wire drives are IP-23 rated providing a high level of protection for harsh environments.

All power sources also feature thermal overload protection, line voltage compensation and Fan-On-Demand™

### Easy to integrate. Our new SubArc

power sources are easy to integrate



by using a standard Modbus® connection. Different levels of integration are possible, from simple remote operation to more complex automated systems.



Power source is warranted for 3 years, parts and labor. Original main power rectifier parts are warranted for 5 years.



### Miller Electric Mfg. Co.

An ITW Company 1635 West Spencer Street P.O. Box 1079 Appleton, WI 54912-1079 USA

### **Equipment Sales US and Canada**

Phone: 866-931-9730 FAX: 800-637-2315

International Phone: 920-735-4554 International FAX: 920-735-4125

### MillerWelds.com





# **SubArc DC Digital**



### SubArc DC 650/800 Digital and DC 1000/1250 Digital

cover most single- and twin-wire applications. These traditional transformer/rectifier power sources combine high efficiency with the highest reliability. They also feature state-of-the-art digital-control electronics to provide best-in-class welding performance and repeatability.

# SubArc DC Digital Specifications (Subject to change without notice.)








Model	Amperage/ Voltage Ranges	Rated Output	IP Rating						, 50/60 575 V		KW	Max. Open- Circuit Voltage**	Dimensions	Net Weight
SubArc DC 650/800 Digital	50-815 A in CC mode 20-44 V in Subarc mode	650 A at 44 V, 100% duty cycle	IP23	126 3.8*	77 1.9*	73 1.8*	66 1.6*	63 1.9*	50.4 1.4*	50 1.52*	34.8 0.76*	72 VDC	H: 27.25 in. (692 mm) (including lift eye) W: 22.25 in. (565 mm) D: 37.5 in. (953 mm)	545 lb. (247 kg)
SubArc DC 1000/1250 Digital	100–1250 A in CC mode 20–44 V in Subarc mode	1000 A at 44 V, 100% duty cycle	IP23	180 5.8*	109 5.2*	104 5.0*	94 4.5*	90 2.9*	72 2.4*	73 3.2*	53 0.5*	66 VDC	(not including strain relief)	644 lb. (292 kg)

<sup>\*</sup>While idling. \*\*Open-circuit voltages in CV mode are factory set at values less than indicated for CC.

SubArc DC 650 Digital and DC 1000 Digital models are certified by Canadian Standards Association to both the Canadian and U.S. Standards.

All SubArc DC Digital models are manufactured and certified in accordance with IEC-60974-1, -10.

# **SubArc DC Digital Control Panel**

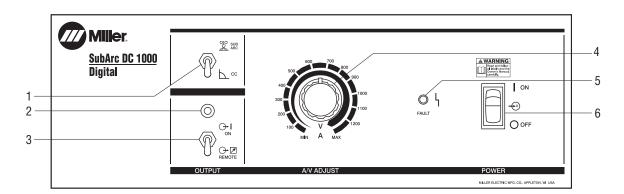

- 1. Process Selector Switch
- 2. Output Indicator Light
- 3. Output Switch (Contactor)

- 4. Amperage/Voltage Adjustment Control
- 5. Fault Indicator
- 6. Power Switch



# **SubArc AC/DC Digital**



SubArc AC/DC 1000/1250 Digital. AC welding output enables the SubArc AC/DC to be used in tandem arc welding systems with a DC lead arc and AC trailing arc, or with AC/AC arc combinations. Using multiple arcs increases deposition rate, resulting in shorter welding cycles for very thick weldments without compromising quality. All AC balance control

modes can be set on the SubArc Interface Digital. The easy-to-understand interface includes two DC modes and 12 best-practice AC balance settings. In multiple-arc configurations, the system automatically adjusts the phase shifting between power sources thereby eliminating arc interaction. There is no need to employ a laptop PC for complex wave shaping before operation.

# SubArc AC/DC Digital Specifications (Subject to change without notice.)








Model	Amperage/ Voltage Ranges	Rated Output	IP Rating		nps Input a Load Vol 400 V (50 Hz)				Max. Open- Circuit Voltage	Dimensions	Net Weight
SubArc AC/DC 1000/1250	300-1250 A in CC mode 20-44 V	1000 A at 44 V, 100% duty cycle	IP23	140 3.0*	141 3.0*	122 3.0*	98 2.37*	53 0.95*	71 VDC	H: 43 in. (1092 mm) (including lift eye) W: 27.5 in. (699 mm)	1225 lb. (540 kg)
Digital	in Subarc mode	1250 A at 44 V, 60% duty cycle		179 3.0*	176 3.0*	158 3.0*	122 2.37*	67 0.95*		D: 47.5 in. (1207 mm) (not including strain relief)	

<sup>\*</sup>While idling.

SubArc AC/DC 1000 Digital model is certified by Canadian Standards Association to both the Canadian and U.S. Standards.

Both SubArc AC/DC Digital models are manufactured and certified in accordance with IEC-60974-1, -10.

# **SubArc AC/DC Digital Control Panel**

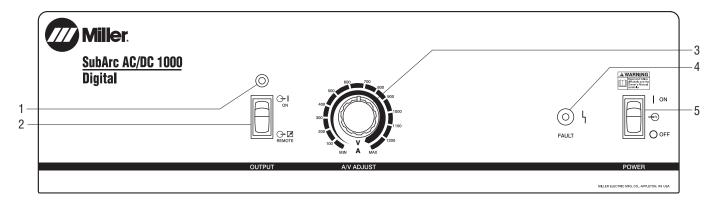


- 1. Output Indicator Light
- 2. Output Switch (Contactor)
- 3. Amperage/Voltage Adjustment Control
- 4. Fault Indicator
- 5. Power Switch



# **SubArc Interface**



**SubArc Interface Analog** 

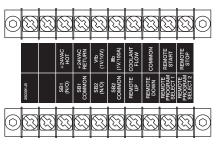

Internal terminal strip is able to integrate with positioners, sidebeams, turning rolls and other peripheral equipment.



**SubArc Interface Digital** 


# SubArc Interface Specifications (Subject to change without notice.)

Model	Type of Input from Welding Power Source	Welding Power Source Type	Weld Voltage and Amperage Capacity	Dimensions	Net Weight
SubArc Interface Analog	Single-phase 24 VAC, 25 A, 50/60 Hz	Constant current (CC), constant voltage (CV), DC with remote contactor and output control capabilities	0-60 V 0-1500 A	H: 7 in. (178 mm) W: 11.25 in. (286 mm)	18 lb. (8.2 kg)
SubArc Interface Digital	Single-phase 24 VAC, 25 A, 50/60 Hz	Constant voltage (CV), AC or DC, with remote contactor and output control capabilities	0-60 V 0-1500 A	D: 11.5 in. (292 mm)	

Certified by Canadian Standards Association to both the Canadian and U.S. Standards.


Manufactured according to the Standard IEC-60974-1, -5, -10.

# **SubArc Interface Control Panels**

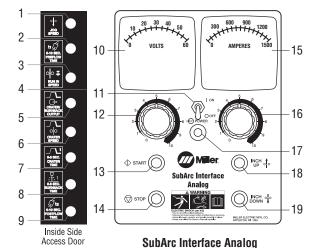

- 1. Jog Speed
- 2. Preflux Time 0-10 Seconds
- 3. Run-In Speed
- 4. CC/CV Switch (Located on Right Side of Access Panel)
- 5. Crater/Burnback Output
- 6. Crater Speed
- 7. Crater Time 0-5 Seconds
- 8. Burnback Time 0-5 Seconds
- 9. Postflow Time 0-10 Seconds

- 10. Voltage Meter
- 11. Power Switch
- 12. Output Control Knob
- 13. Start Button
- 14. Stop Button
- 15. Amperage Meter
- 16. Wire Feed Speed Control Knob
- 17. Indicator Light
- 18. Wire Inch Up
- 19. Wire Inch Down

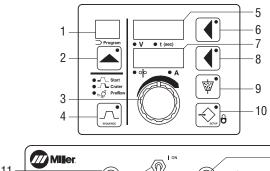




SubArc Interface Digital

- 1. Program Display
- 2. Program Push Button
- 3. Adjust Control
- 4. Sequence Push Button
- 5. Upper Display
- 6. Upper Display Push Button
- 7. Lower Display
- 8. Lower Display Push Button
- 9. Flux Push Button
- 10. Setup Push Button
- 11. Start Button
- 12. Power Switch
- 13. Stop Button
- 14. Wire Inch Up
- 15. Wire Inch Down



# **SubArc Interface Setup**

In the new setup the positive sense lead is integrated in the wire feeder motor cable and control cable. A customer supplied negative sense lead is required for optimal performance.

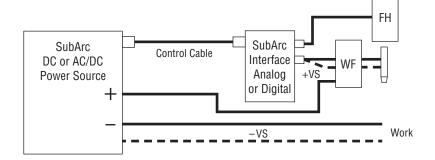

# **SubArc Modbus® Operation**

### **Easy Method** Modbus All other items Integrator-Communication in system: Supplied positioner, Interface rolls,etc. FH SubArc SubArc Control Interface DC or AC/DC Cable Analog +VS **Power Source** or Digital -VS Work

**Easy method** of integrating standard components while controlling them over Modbus communication. Using the standard SubArc Interface, wire feed motor and flux hopper, an integrator can remotely adjust settings and operation of the SubArc Interface. A separate document with interfacing information is available.

# Modbus Communication Supplied Interface IntegratorSupplied Interface All items in the system including integrator-supplied feed motor, etc. SubArc DC or AC/DC Power Source + VS - VS Work

**High-Level Method** 

**High-level method** where the integrator solely uses the digital power sources and controls them over Modbus communication. Benefits from Miller technology-driven arc performance while integrating into a custom-made welding solution.

# **SubArc System Parallel and Tandem Setups**

### **Parallel Connections** DC or AC/DC Controlling Unit DC or AC/DC Following Unit(s) RC3 RC2 RC3 (Blue) (White) (Blue) (White) 0 0 0 0 0 0 0 To Work To Work White To RC1 on Next Unit To Electrode

**Parallel setup.** Only like power sources can be paralleled. Paralleling of two machines to increase maximum welding current is simply done by connecting the paralleling cable from RC2 on the first unit to RC1 on the second unit. This works for both DC as well as AC/DC machines. Daisy chaining multiple machines to gain higher output is done in the same way. No special tools, laptop or software needed... plug and play.

### **Tandem Connections** DC or AC/DC Lead Unit AC Trail Unit(s) RC3 RC2 RC3 RC2 (Blue) (White) (Blue) (White) 00 00 00 00 To AC or DC To AC Output To Work To Work Output Electrode #2 Electrode #1 To RC3 on White Blue Next AC Unit

**Tandem setup.** To use two or more AC arcs, the arc must be phase shifted to prevent arc to arc interaction. This is simply done by connecting the tandem cable from RC2 on the first unit to RC3 on the second unit. This automatically sets the optimum phase shift for AC welding. No special tools, laptop or software needed... plug and play.



# **Wire Drive Assemblies**



SubArc Strip Drive 100 Digital Low Voltage #300 939 #300 940\* With mounting bracket

Heavy-duty, right-angle wire drive assembly designed for automated strip clad applications.



SubArc Wire Drive 400 Digital Low Voltage #300 938\* Standard speed #300 938 001 Standard speed, for use with Tractor

SubArc Wire Drive 780 Digital Low Voltage #300 941\* High speed

Right-angle wire drive assembly.

\*Includes adapter plate allowing mounting to 2.5-, 4.25-, and 4.625-inch bolt-hole patterns.

# Wire Drive Assembly Specifications (Subject to change without notice.)

Model	Wire Feed Speed Range	Wire Diameter Range	Rating	Type of Input Power	Input Power Cord	Weight
SubArc Strip Drive 100 Digital Low Voltage	10-69 IPM (0.3-1.6 m/min.)	N/A (Strip cladding applications)	1/5 HP, 21 RPM	38 VDC	4 ft. (1.2 m)	20 lb. (9.1 kg)
SubArc Wire Drive 400 Digital Low Voltage	30-400 IPM (0.8-10.2 m/min.)	3/32 – 7/32 in. (2.4 – 5.6 mm)	1/5 HP, 85 RPM	38 VDC	4 ft. (1.2 m)	33 lb. (15 kg)
SubArc Wire Drive 400 Digital Low Voltage for Tractor						
SubArc Wire Drive 780 Digital Low Voltage	50-780 IPM (1.3-19.8 m/min.)	1/16-1/8 in. (1.6-3.2 mm)	1/4 HP, 143 RPM	38 VDC	4 ft. (1.2 m)	33 lb. (15 kg)

# **Accessories**

# **Drive Rolls**

"V" Knurled drive rolls for use with hard-shelled cored wires.

**#132 955** 1/16 in. (1.6 mm) **#132 960** 5/64 in. (2.0 mm) **#132 961** 3/32 in. (2.4 mm)

**#132 962** 7/64 in. (2.8 mm) **#132 963** 1/8 in. (3.2 mm)

**#193 700** 5/32 in. (4.0 mm) **#193 701** 3/16 in. (4.8 mm)

**#193 702** 7/32 in. (5.6 mm)



# **Cables**

**SubArc Control Cables** 

**#260 622 030** 30 ft. (9.1 m)

#260 622 050 50 ft. (15.2 m)

#260 622 080 80 ft. (24.4 m)

#260 622 100 100 ft. (30.5 m)

#260 622 120 120 ft. (36.6 m)

#260 622 200 200 ft. (61.0 m)

Cable between SubArc Interface and power source.

**Motor Extension Cables** 

#254 232 010 10 ft. (3 m)

**#254 232 025** 25 ft. (7.6 m)

**#254 232 065** 65 ft. (19.8 m)

Cable between SubArc Interface and drive motor.

**Flux Hopper Extension Cables** 

#260 623 010 10 ft. (3 m)

**#260 623 025** 25 ft. (7.6 m)

**#260 623 065** 65 ft. (19.8 m)

Cable between SubArc Interface and flux hopper.

SubArc Parallel Cable

**#260 775 015** 15 ft. (4.6 m)

**SubArc Tandem Cable #260 878 015** 15 ft. (4.6 m)



# **Accessories**

# **Submerged Arc Torches**



### OBT 600 #043 923

600-amp, 100-percent-duty-cycle torch with concentric flux flow nozzle. Can be used with 1/16-7/32 inch (1.6-5.6 mm) wire.

### **OBT 600 Torch Body Extensions**

**#043 967** 1 inch (25.4 mm) **#043 969** 2 inch (50.8 mm)

#043 973 4 inch (101.6 mm)

**#043 975** 6 inch (152.4 mm)



### OBT 1200 #043 900

1200-amp, 100-percent-duty-cycle torch with concentric flux flow nozzle. Can be used with 1/16-7/32 inch (1.6-5.6 mm) wire. OBT 1200 features a replaceable breakaway adapter end to prevent costly damage should torch run into an obstruction.

### OBT 1200 Torch Body Extension #043 981

Overall length with extension is 9 inches (228.6 mm). Actual length of extension is 8.5 inches (215.9 mm).

# **OBT Torch Contact Tips**

OBT 600	OBT 1200	Wire Size
#192 700	#192 141	1/16 in. (1.6 mm)
#192 701	#199 026	5/64 in. (2.0 mm)
#192 702	#192 142	3/32 in. (2.4 mm)
#192 703	#200 771	7/64 in. (2.8 mm)
#192 704	#192 143	1/8 in. (3.2 mm)
#192 705	#192 144	5/32 in. (4.0 mm)
#192 706	#192 136	3/16 in. (4.8 mm)
#192 707	#200 756	7/32 in. (5.6 mm)



### 1200-Amp Single-Wire Torches

**#301 141** Short, 11.3 in. (288 mm) 1200-amp torch for 1/16 – 5/32 inch (1.6 – 4.0 mm) wires.

# 1200-Amp Single-Wire Torch Contact Tips

**#264 590** 1/16 in. (1.6 mm)

**#264 591** 5/64 in. (2.0 mm)

#264 487 3/32 in. (2.4 mm)

**#264 593** 1/8 in. (3.2 mm)

#264 594 5/32 in. (4.0 mm)

### 1200-Amp Twin-Wire Torches

#301 143 Short, 11.3 in. (288 mm)

**#301 144** Long, 16.8 in. (427 mm)

1200-amp torches for 3/64 – 3/32 inch (1.2 – 2.4 mm) wires.

### **1200-Amp Twin-Wire Torch Contact Tips**

**#264 595** 3/64 in. (1.2 mm)

#264 596 1/16 in. (1.6 mm)

#264 597 5/64 in. (2.0 mm)

#264 588 3/32 in. (2.4 mm)



# **Internal and External Cladding Heads**

Our range of external Strip Cladding Heads are designed for both Electroslag and Submerged Arc strip cladding. Strip size may vary from 1-3/16 to 4-3/4 inches (30 to 120 mm). The internal Strip Cladding Heads are designed for Submerged Arc strip cladding. Strip size is standard 1-3/16 inch (30 mm).

# Contact Miller for a full overview of welding torches and cladding heads.



# SubArc Flux Hopper Digital Low Voltage #300 942

Flux hopper with automatic flux valve will carry 25 pounds of flux. The opening is sized to allow hook-up of any fluxhopper-mounted recovery system. A

slag screen is also provided. Includes 11-foot (3.3 m) power cord.

### Single-Wire Straightener #199 733

For use with SubArc Wire Drive 400 Digital Low Voltage or 780 Digital Low Voltage. For 1/16 – 7/32 inch (1.6 – 5.6 mm) wires.

# **Twin-Wire Straightener**

**#301 160** Single adjustment **#301 162** Double/separate adjustment

For Twin-Wire Torches only.



# Wire Reel #108 008 For 60-pound (27 kg) coil of wire. Requires Spool Support Assembly

(#119 438).

**Spool Support Assembly** #119 438 For 60-pound (27 kg) wire reel.

### Light-Duty Cross Slide #195 411

Allows six inches of travel adjustment. Two units can be stacked to provide vertical and horizontal movement. *Not recommended for tandem.* 

### Heavy-Duty Cross Slide #300 482

One-inch-diameter, precision, hardened and ground guide rods provide a perfect path for the sealed linear bushings, and smooth accurate movement of the weld head. Allows for six inches of travel adjustment and has a load capacity of 200 pounds. *Recommended for tandem.* 

# Contact Miller for a full overview of powered or manual slides.



SubArc Tractor

#300 945 Tractor only

**#951 615** Analog Weld Control Package

#951 614 Digital Weld Control Package
SubArc tractor packages include SubArc Tractor
with remote start/stop control and guide rolls,
SubArc Interface weld controller (analog or
digital), SubArc Wire Drive 400 for Tractor,
25-lb. (11.3 kg) capacity flux hopper with valve,
60-lb. (27 kg) wire reel, OBT 600 torch and
wire straightener

See Lit. No. AD/7.5 for more information.



# **Ordering Information**

Equipment and Options	Stock No.	Description	Qty.	Price
SubArc DC 650 Digital	#907 622	230/460/575 V, 60 Hz		
SubArc DC 800 Digital (50 Hz)	#907 623	380/400/440 V, 50 Hz		
SubArc DC 1000 Digital	#907 624	230/460/575 V, 60 Hz		
SubArc DC 1250 Digital (50 Hz)	#907 625	380/400/440 V, 50 Hz		
SubArc AC/DC 1000 Digital	#907 620	460 V, 60 Hz		
	#951 618	575 V, 60 Hz with 575 V to 460 V step-down transformer		
SubArc AC/DC 1250 Digital (50 Hz)	#907 621	380/400 V, 50 Hz		
Controls				
SubArc Interface Analog	#300 937	CC/CV, DC analog control		
SubArc Interface Digital	#300 936	CV, AC/DC digital control		
Drive Motors				
SubArc Strip Drive 100 Digital Low Voltage	#300 939	Heavy-duty, right-angle drive motor for automated strip clad applications		
	#300 940	Same as above with mounting bracket		
SubArc Wire Drive 400 Digital Low Voltage	#300 938	Standard-speed, right-angle drive assembly. Maximum speed 400 IPM (10 mpm)		
	#300 938 001	Same as above for use with Tractor		
SubArc Wire Drive 780 Digital Low Voltage	#300 941	High-speed, right-angle drive assembly. Maximum speed 780 IPM (19.8 mpm)		
Drive Rolls		See page 6		
Torches				+
OBT 600	#043 923	600 amp, 100% duty cycle, air cooled		
OBT 600 Torch Body Extensions	#043 967	1 in. (25.4 mm)		+
CDT CCC TOTAL BODY Extendions	#043 969	2 in. (50.8 mm)		
	#043 973	4 in. (101.6 mm)		
	#043 975	6 in. (152.4 mm)		
OBT 1200	#043 900	1200 amp, 100% duty cycle, air cooled		
OBT 1200 Torch Body Extension	#043 981	9 in. (228.6 mm)		
1200-Amp Single-Wire Torches	#301 141	Short, 11.3 in. (288 mm), 1200 amp		
1200-Amp Twin-Wire Torches	#301 143	Short, 11.3 in. (288 mm), 1200 amp		
	#301 144	Long, 16.8 in. (427 mm), 1200 amp		
Contact Tips		See page 7 for contact tips for all torches		
Internal and External Cladding Heads		Contact Miller		
Accessories				
SubArc Control Cables		See page 6		
Motor Extension Cables		See page 6		
Flux Hopper Extension Cables		See page 6		
SubArc Parallel Cable	#260 775 015	15 ft. (4.6 m)		
SubArc Tandem Cable	#260 878 015	15 ft. (4.6 m)		
SubArc Flux Hopper Digital Low Voltage	#300 942	25-lb. (11 kg) flux capacity		
Single-Wire Straightener	#199 733	For SubArc Wire Drive 400 Digital Low Voltage or 780 Digital Low Voltage		
Twin-Wire Straightener	#301 160 #301 162	Single adjustment for Twin-Wire Torches only Double/separate adjustment for Twin-Wire Torches only		
Wire Reel	#108 008	For 60-lb. (27 kg) coil, requires Spool Support Assembly (#119 438)		
Spool Support Assembly	#119 438	Support for 60-lb. reels	İ	
Light-Duty Cross Slide	#195 411	Provides 6-in. travel adjustment, load capacity of 150 lb.		
Heavy-Duty Cross Slide	#300 482	Provides 6-in. travel adjustment, load capacity of 200 lb.		
SubArc Tractor		See page 7		1

Date: Total Quoted Price:

Distributed by:

